

DEPARTMENT OF TRANSPORTATION**DIVISION OF ENGINEERING SERVICES**

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-021878**Date Inspected:** 02-Nov-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Xu Le Feng /Qiu Wen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Bike Path**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Scott Leavitt, was present during the times noted above for observations relative to the work being performed.

Bay 10 – Tower Shop

In Process Inspection FCAW

This QA Inspector observed the following work in progress: FCAW welding of weld joint 072 located on BK004A6-028. Welder is identified as 053869. ZPMC Quality Control (QC) is identified as Qui Wen. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of weld joint 073 located on BK004A6-028. Welder is identified as 040533. ZPMC Quality Control (QC) is identified as Qui Wen. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of weld joint 043 located on BK004A1-029. Welder is identified as 053869. ZPMC Quality Control (QC) is identified as Lu Ye Tei. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of temporary stiffeners located on BK004A1-025. Welder is identified as 040533. ZPMC Quality Control (QC) is identified as Lu Ye Tei. The welding variables recorded by QC appeared to comply with the Applicable WPS.

Bay 11 – Tower Shop

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

In Process Inspection FCAW

This QA Inspector observed the following work in progress: FCAW welding of weld joint 044 located on BK004C-024. Welder is identified as 040723. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of weld joint 144 located on BK004C7-024. Welder is identified as 040655. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

In Process Inspection SMAW

This QA Inspector observed the following work in progress: SMAW tack welding of top plate to stiffeners located on BK8A-BKX15. Welder is identified as 052641. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA inspector observed ABF Quality Assurance (QA) personnel performing MT of welds on cover for member identified as BK004A-053.

Magnetic Particle Inspection (MT)


The following Non Destructive Testing (NDT) inspection carried out as per the ZPMC submitted Notification No 07200

This QA inspector performed MT of approximately 15% of an area that has been previously tested and accepted by ZPMC Quality Control (QC) personnel. This QA Inspector generated an MT report for this date.

The members are identified as:

BK004ASD1-053-009, 010, 011, 012, 013, 015, 016, 017, 019, 020, 025, 026

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

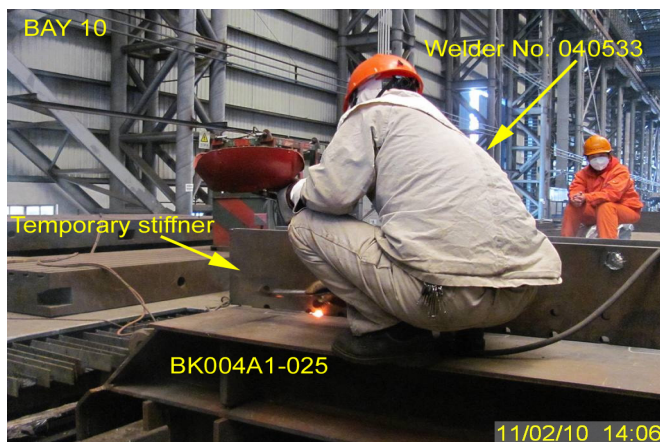

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Summary of Conversations:

No relevant conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang at 15000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Leavitt, Scott	Quality Assurance Inspector
----------------------	----------------	-----------------------------

Reviewed By:	Clifford, William	QA Reviewer
---------------------	-------------------	-------------